

City of Baltimore Wet Weather Consent Decree Smoke and Dyed Water Testing Form

Page 1 of 2

Sewershed: Gwynns Falls

Company: Savin

Date: 4/22/2009

Test to be performed:

Smoke ☐ Dyed Water ☒

Ground Condition:

Dry ☒ Damp ☐ Wet ☐

Supervisor: JAW


Manhole_ID: S04EE1013MH

Test ID: D1032-028010

Notification Made: NA

(Residents, Fire, 311)

Field Sketch: Show all manholes with Numbers, Blower Placement Locations, Sandbag or Isolation Locations, Street Names, Building Addresses and Locations, Defect Locations and Photo Numbers.

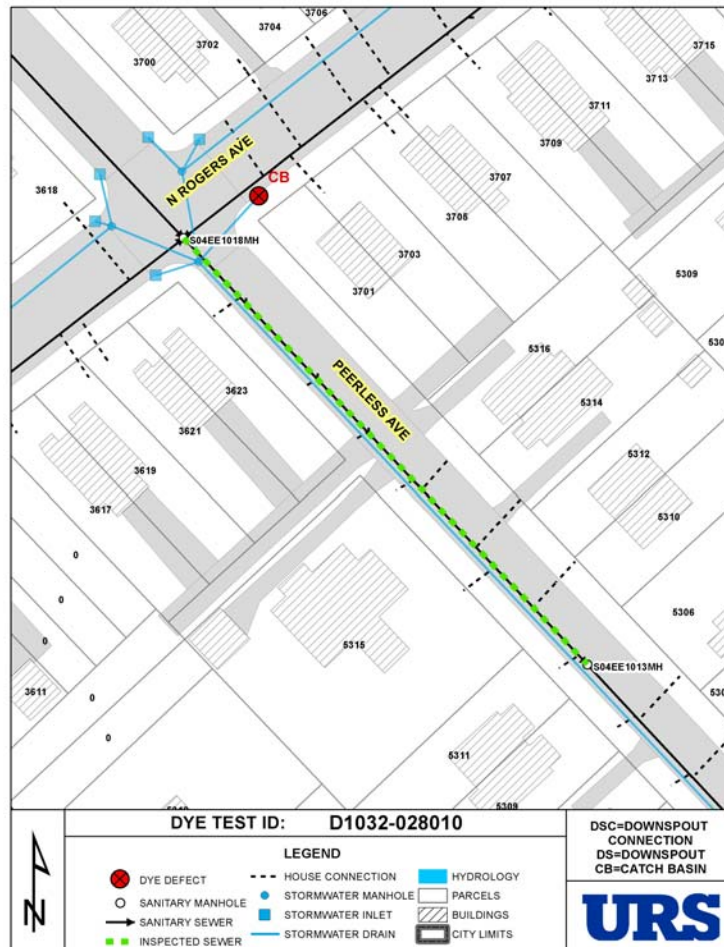

Defect Loc	Obs_ClockFrom	Obs_ClockTo	Observation	Obs_Remarks
0			Start of Survey	
0			Manhole	S04EE1018MH
0			Water Level	
3.5	10	02	Fracture Multiple	@ jt
3.5			Dye Test Visible	@ jt/FM, 0.5gpm
6.5			Dye Test Visible	@ IR, <0.1gpm
9.5			Dye Test Visible	@ IR, 0.25gpm
12.69999981	02		Infil Runner	@ jt
13			Dye Test Visible	@ IR, <0.1gpm
15.60000038			Dye Test Visible	@ IR, 0.5gpm
19.20000076	09		Infil Runner	@ jt, 0.5gpm

City of Baltimore Wet Weather Consent Decree Smoke and Dyed Water Testing Form		Page 2 of 2
Sewershed: <u>Gwynns Falls</u>	Company: <u>Savin</u>	Date: <u>4/22/2009</u>
Test to be performed: Smoke <input type="checkbox"/> Dyed Water <input checked="" type="checkbox"/>	Ground Condition: Dry <input checked="" type="checkbox"/> Damp <input type="checkbox"/> Wet <input type="checkbox"/>	Supervisor: <u>JAW</u>
Manhole_ID: <u>S04EE1013MH</u>	Test ID: <u>D1032-028010</u>	Notification Made: <u>NA</u> (Residents, Fire, 311)

21.20000076		Dye Test Visible	@ IR, 0.1gpm
27.39999962	03	Infil Runner	
30.70000076	08	04 Fracture Multiple	@jt
30.70000076		Dye Test Visible	@ IR & FM, 0.1gpm
35.5		Dye Test Visible	@ FM, 0.1gpm
38.5	02	Tap Factory	
38.5		Dye Test Visible	@ TF, 0.1gpm
39.90000153	10	Tap Factory Capped	
40	10	Infil Dripper	@ TFC
47.40000153		Dye Test Visible	@ IR, 0.1gpm
50.40000153		Dye Test Visible	@ IR, 0.1gpm
58.29999924	02	Tap Break-in Intruding	
59		Abandoned Survey	DYE FLOOD COMPLETED